Remote Display Mounting Instructions

Screw anchor

1-3/16"

Screw anchor

2-3/16"

1) Insert mounting clip onto the bottom of the display
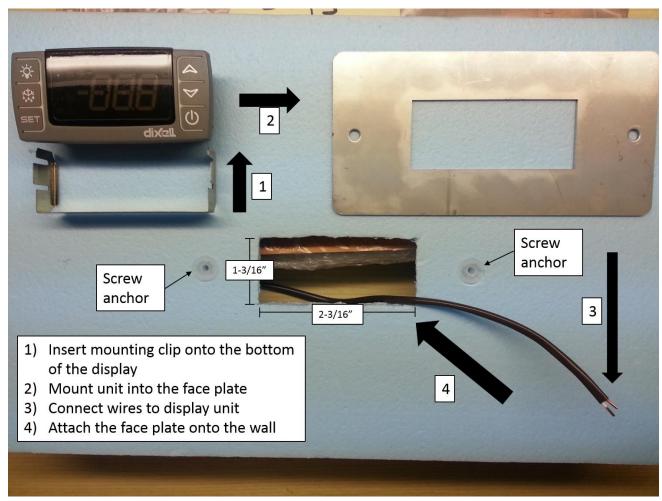2) Mount unit into the face plate
3) Connect wires to display unit
4) Attach the face plate onto the wall

1. Run the wire from the face of the cooling unit to the desired location of the display. To extend the wire, use 18 gauge, 2-conductor thermostat wire.
2. Place the stainless steel faceplate against the wall in its desired mounting location, and mark the location of the two holes and outline the cutout. Set the faceplate aside.
3. Using a 3/16" drill bit, drill holes in the two hole locations. (The holes should be 4-3/4" apart (center to center).
4. Using a saw, cut out the outline for the display unit. The cutout should be 2-13/16"W x 1-3/16"H.
5. Insert the supplied screw anchors into the 2 holes in the wall.
6. Attach the metal mounting clip onto the display unit. Make sure the long side of the clip covers the bottom of the display unit, and that the sides of the mounting clips fall into the grooves of the display unit. The grooves are located about 1/2" towards the rear of the display (from the front.)
7. Slide the display unit & clip into the face plate. Make sure that they snap into place.
8. Attach the wires to the terminals on the rear of the display unit. **The red wire goes to the (+) terminal, and the white wire goes to the (–) terminal.**
9. Mount the faceplate onto the wall with the supplied screws.